



**CERVANTES TRUCK CENTER, INC.**  
 5502 STATE HIGHWAY 359  
 LAREDO, TX 78043  
 PHONE (956) 723-0860

# Invoice

DATE	INVOICE #
9/11/2015	36219

**BILL TO:**

Webb County  
 1110 Washington Street, Suite #101  
 Laredo, Tx 78040

P.O. NUMBER	TERMS	PROJECT
15-00007775	Net 30	

QUANTITY	DESCRIPTION	RATE	AMOUNT
1	Computer Diagnostic Engine: Cummins Engine S/N:57924438 Detected: Fault Codes: 1993 Aftertreatment 1 Diesel Particulate Filter Missing; 1883 Aftertreatment Diesel Particulate Filter Differential Pressure Sensor; 0151 Engine Coolant Temperature; 2963 Data Valid But Above Normal Operating Range Updated Software; Run A Complete Regen	250.00	250.00
1	Diesel Truck Service Drain Coolant To Remove & Replace Water Pump, Thermostat, Temperature & Coolant Sensors; Add New Antifreeze	260.00	260.00
1	Diesel Truck Service Check EGR Cooler; Remove Hose From EGR Cooler To Check EGR Cooler For Any Coolant Leaks; No Leaks Were Detected; Remove EGR Valve & Detected Bad EGR Valve; Remove All Necessary Components To Remove & Replace EGR Valve, EGR Delphi & Clamp With Gasket; Reinstall All Components; Re-Test Truck	260.00	260.00
1	Diesel Truck Service - Front Suspension Detected Bolt From Shock Support Is Broken; Remove Shock Support From Truck To Remove Broken Bolt; Reinstall Shock Support With New Bolt	195.00	195.00
1	Diesel Truck Service Check Transfer Case; Detected Broken Bolt From Transfer Case; Drill Out Bracket To 3/4 Hole; Install Four (4) New Bolts	195.00	195.00
1	Diesel Truck Service Check Transfer Case Leak; Detected Leak Coming From Seal; Remove Driveshaft To Remove & Replace Yoke Seal; Reinstall Driveshaft & Add Gear Oil	195.00	195.00

All work is complete!

**TOTAL**



**CERVANTES TRUCK CENTER, INC.**  
 5502 STATE HIGHWAY 359  
 LAREDO, TX 78043  
 PHONE (956) 723-0860

# Invoice


DATE	INVOICE #
9/11/2015	36219

**BILL TO:**

Webb County  
 1110 Washington Street, Suite #101  
 Laredo, Tx 78040

P.O. NUMBER	TERMS	PROJECT
15-00007775	Net 30	

QUANTITY	DESCRIPTION	RATE	AMOUNT
1	Diesel Truck Service Remove Complete DPF Filter To Get Checked; Detected Is Good; Reinstall DPF Filter With New Gasket & Clamp	390.00	390.00
1	4955394 Water Pump	102.20	102.20
1	5292712 Thermostat	31.00	31.00
2	AF50/50 Antifreeze	16.00	32.00
1	4954905 Coolant Sensor	12.60	12.60
1	8C4Z-10D968-AA Temperature Sensor	22.40	22.40
1	4309085RX EGR Valve	560.00	560.00
1	4921728 EGR Delphi	178.55	178.55
2	3957456 Clamp	44.00	88.00
2	3949910 Gasket	2.38	4.76
1	1/2x4 Bolt	3.00	3.00
1	Bolt Kit	20.00	20.00
1	A1-1205Y2729 Rear Out Put Seal	70.00	70.00
1	80W90 Gear Oil	18.00	18.00
1	4921730 Exhaust Pressure Sensor	126.00	126.00
2	2871451 DPF Gasket	38.00	76.00
2	Q187680 DPF V-Clamp	60.00	120.00
3	2872468 Temperature Sensor	93.00	279.00
1	Shipping & Handling	95.00	95.00
1	Shop Supplies	10.00	10.00

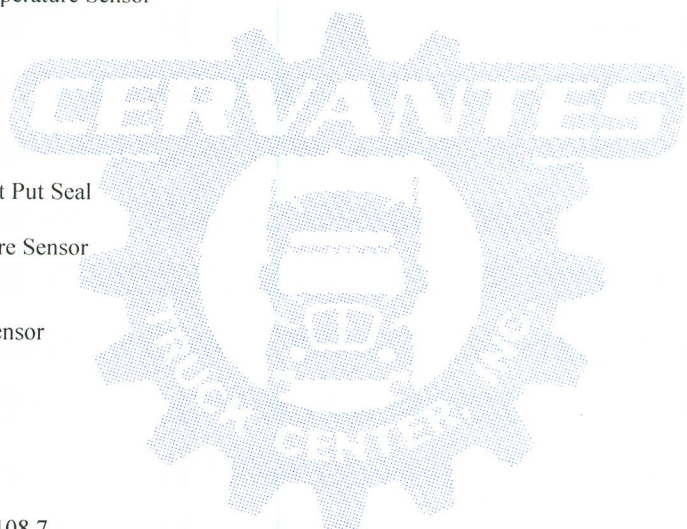

2010 Ford F-750  
 Unit #5804  
 Mileage:35252 \* Hours:108.7  
 LIC #111-6741  
 VIN #3FRXW7FH7AV274777

C.C.

All work is complete!

**TOTAL** \$3,593.51